


ITEM	QTY	ASSET #	INVENTORY NO.
-	-	-	-

M2-20

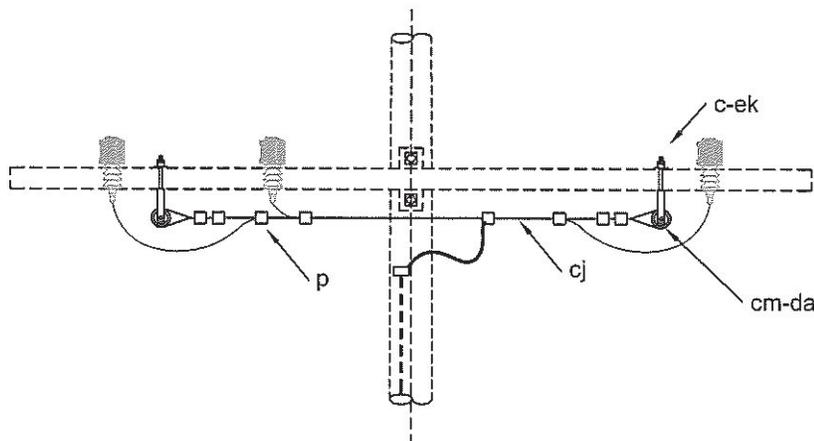


NOTES:

1. Fiberglass crossarms to be used in place of or substituted for wooden crossarms.
2. Factory drilled holes per CORE M19 type 05.
3. Center holes reserved for ground wire spools.

ITEM	QTY	MATERIAL	INVENTORY NO.
c	2	Bolt, machine, 5/8" x req'd. length	063805TT
p	9	Connectors, compression, #6 CU C Crimp	17030600
cm	2	Insulator, spool, 3"	34263010
cj	*	Ground wire, #6 copper or equiv.	15610501
da	2	Bracket, Clevis, Fbgls Crossarm Gnd	07804510
ek	*	Double coil spring washers, as req'd.	-

ITEM	QTY	ASSET #	INVENTORY NO.
-	-	-	-

M2-20A

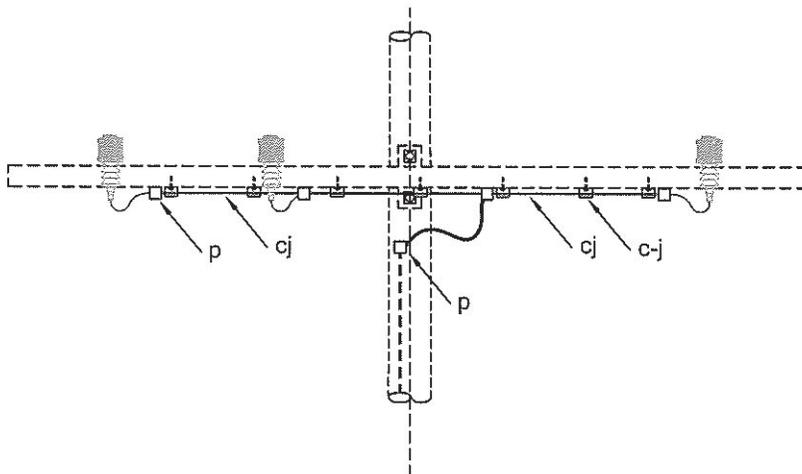

ITEM	QTY	MATERIAL	INVENTORY NO.
c	7	Clip Ground Wire CU	45411152
j	7	Screw 12-14x1 3/4 # 3 Point	06390540
p	5	Connectors, compression, #6 CU C Crimp	17030600
cj	*	Ground wire, #6 copper or equiv.	15610501

FIBERGLASS CROSSARM GROUNDING

APR. 1983

REVISED  
FEB 2026



APPROVED BY  
WET

MISC. ASSEMBLIES  
12.47/7.2 kV

M2-20  
M2-20A

\*Quantity as Required